



SERVICE BULLETIN

Classification: MT95-002	Reference: NTB95-091	Date: September 20, 1995
------------------------------------	--------------------------------	------------------------------------

1995 MAXIMA CLUTCH SLIP

APPLIED VEHICLE: 1995 Maxima (A32)
C/M APPLIED DATE: 3/16/95

SERVICE INFORMATION

Some 1995 Maxima manual transmission customers may experience clutch slipping. The incident may occur on hard acceleration in 4th or 5th gear.

To correct this incident the material for the clutch disc has been changed to help prevent clutch slipping.

SERVICE PROCEDURE

Verify that the vehicle exhibits clutch slipping on hard acceleration in 4th or 5th gear. If clutch slipping occurs:

- Replace the clutch disc with the countermeasure disc (part no. 30100-40U11).
- Inspect the clutch cover and flywheel for visible signs of wear and/or heat discoloration.
- Replace the clutch cover only if signs of wear and/or heat discoloration are visible.

PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Clutch Disc	30100-40U11	1
Clutch Cover	30210-40U03	1

CLAIMS INFORMATION

OPERATION	OP CODE	PNC*	SYMPTOM	DIAGNOSIS	FRT
RPL CLUTCH COVER / DISC ASSY'S	HB10AA	30100	ZF	24	4.0 HRS

Note*: New Claims System dealers should submit a Primary Part claim P/N 30100-40U11.

Copyright © 1995 NISSAN MOTOR CORPORATION, U.S.A.
Technical Communications Department

No part of this bulletin may be reproduced, stored in a retrieval system, or transmitted in any form, or by any means electronic, mechanical, photocopying, recording or otherwise, without the prior written permission of Nissan Motor Corporation U.S.A. Printed in U.S.A.

.....
Index # 044579
.....