



SERVICE BULLETIN

Classification: EC96-002	Reference: NTB96-008a	Date: March 6, 1996
-----------------------------	--------------------------	------------------------

1995-96 ALTIMA/MAXIMA/SENTRA/200SX MIL LIGHT 'ON' CODE P0136

This amended version of NTB96-008 presents new information concerning the applied vehicles.
Please discard NTB96-008

APPLIED VEHICLES:
 1995-96 Altima (U13) (Except '96 Cal)
 1995-96 Maxima (A32)
 1995-96 Sentra/200SX (B14)

SERVICE INFORMATION

If the MIL (Malfunction Indicator Lamp) is 'ON', and a DTC (Diagnostic Trouble Code) P0136 (rear heated oxygen sensor) is found stored in ECM memory, use the following procedure to repair the vehicle.

SERVICE PROCEDURE

1. Perform the checks outlined in the service manual EC section for this DTC.
2. If no problem is found with the rear heated oxygen sensor **circuit**, replace the sensor with the appropriate countermeasure part listed below.
3. Erase the DTC.
4. Confirm operation of the new rear heated oxygen sensor using OVERALL FUNCTION CHECK in the service manual.

 047714

PARTS INFORMATION

DESCRIPTION	PART #/PFP	QUANTITY
Rear Heated Oxygen Sensor	226A0-40U60	1
Rear Heated Oxygen Sensor GA16DE (Cal only)	226A0-1M560	1

CLAIMS INFORMATION

OPERATION	OP CODE	PNC ¹	SYMPTOM	DIAGNOSIS	FRT
RPL Rear Heated Oxygen Sensor	DE49AA	22691	HD	32	0.3 hrs (B14) 0.4 hrs (U13, A32)

NOTES: 1. New Claims System dealers: Submit a Primary Part claim using either P/N 226A0-40U60 or 226A0-1M560 as the Primary Failed Part.

Copyright © 1996 NISSAN MOTOR CORPORATION, U.S.A.
Technical Communications Department

No part of this bulletin may be reproduced, stored in a retrieval system, or transmitted in any form, or by any means electronic, mechanical, photocopying, recording or otherwise, without the prior written permission of Nissan Motor Corporation U.S.A. Printed in U.S.A.