



SERVICE BULLETIN

Classification:

AT96-007

Reference:

NTB96-084

Date:

August 21, 1996

OBD-II "A/T INITIAL START" TROUBLE CODE

This bulletin supersedes NTB94-080a (AT94-005a). Please discard NTB94-080a.

APPLIED VEHICLES:

All vehicles equipped with OBD-II and automatic transmission

SERVICE INFORMATION

"A/T INITIAL START" may appear when you access the self-diagnostic results in the A/T system using CONSULT (see Figure 1).

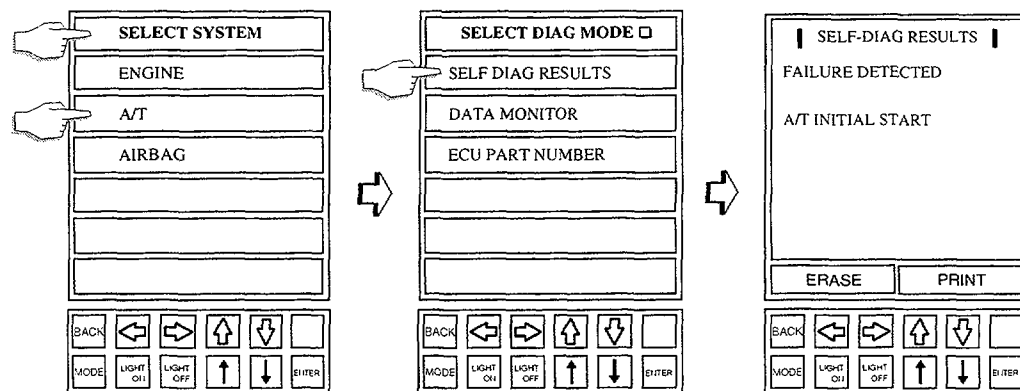


Figure 1

This message indicates that the self-diagnosis results of self-learning have not been memorized in the A/T control unit. This message is stored in the self-diagnosis memory of the A/T control unit whenever the following systems are disrupted:

- The battery cable is disconnected or the battery is replaced
- The power supply line is short circuited
- The connector at the A/T control unit has poor contact
- The fuse in the power supply circuit burns out
- The connector from the A/T control unit is disconnected
- The A/T control unit is replaced
- The battery runs down.

SERVICE PROCEDURE

Erase "A/T INITIAL START" from the self-diagnostic results using CONSULT (see Figure 2). An actual DTC would have replaced "A/T INITIAL START" if there had been an incident with the transmission after the power to the A/T control unit was interrupted. Therefore, it is not necessary to drive the vehicle after erasing the DTC.

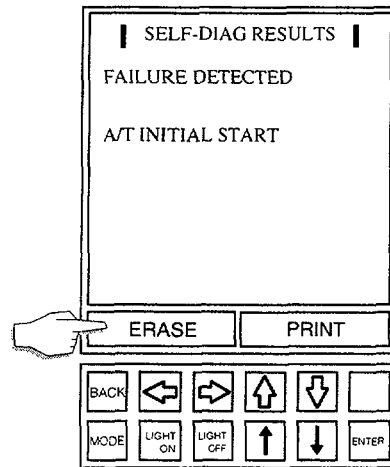


Figure 2