



SERVICE BULLETIN +


Classification: AT-005	Section: Automatic Transmission	Models: 1995 Maxima & 240SX
Reference: TECHNICAL BULLETIN NTB94-080		Date: August 9, 1994

1995 240SX AND MAXIMA OBD-II A/T INITIAL START TROUBLE CODE

APPLIED MODEL: 1995 (S14) 240SX
1995 (A32) Maxima

SERVICE INFORMATION

"A/T INITIAL START" may appear when you access the self-diagnostic results in the A/T system using CONSULT.

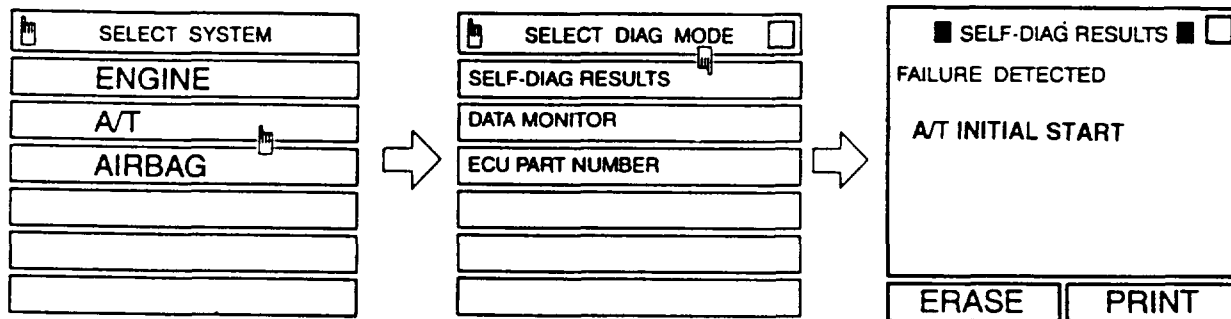

This message indicates that the self-diagnosis results of self-learning have not been memorized in the automatic transmission control unit.

This message is stored in the self-diagnostic memory of the automatic transmission control unit whenever the following systems are disrupted:

- The battery cable is disconnected
- The power supply line is short circuited
- The connector at the control unit has poor contact
- The fuse in the power supply circuit burns out
- The connector from the control unit is disconnected
- The control unit is replaced
- The battery runs down
- The battery is replaced

.....
Index # **039154**
.....