

SERVICE BULLETIN


Classification: AT-005a	Section: Automatic Transmission	Models: 1995 Maxima & 240SX
Reference: TECHNICAL BULLETIN NTB94-080a	Date: September 6, 1994	

1995 240SX AND MAXIMA OBD-II A/T INITIAL START TROUBLE CODE

APPLIED MODEL: 1995 (S14) 240SX
 1995 (A32) Maxima

SERVICE INFORMATION

“A/T INITIAL START” may appear when you access the self-diagnostic results in the A/T system using CONSULT.

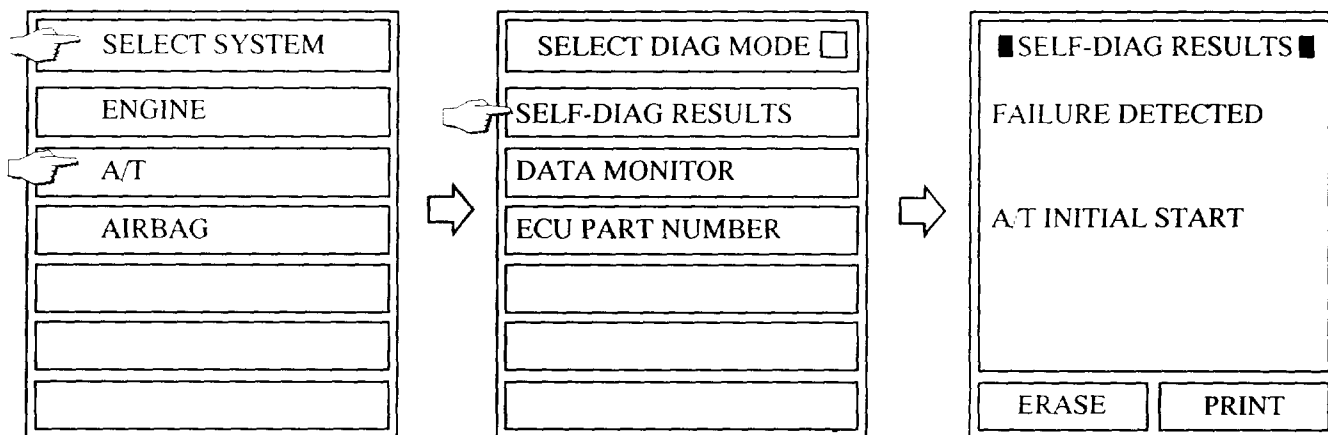

This message indicates that the self-diagnosis results of self-learning have not been memorized in the automatic transmission control unit.

This message is stored in the self-diagnostic memory of the automatic transmission control unit whenever the following systems are disrupted:

- The battery cable is disconnected
- The power supply line is short circuited
- The connector at the control unit has poor contact
- The fuse in the power supply circuit burns out
- The connector from the control unit is disconnected
- The control unit is replaced
- The battery runs down
- The battery is replaced

SERVICE PROCEDURE

Erase "A/T INITIAL START" from the self-diagnostic results using CONSULT.

■ SELF-DIAG RESULTS ■	
FAILURE DETECTED	
A/T INITIAL START	
ERASE	PRINT

Since an actual A/T DTC will over-ride "A/T Initial Start" code, it is not necessary to drive the vehicle after erasing the code. An actual DTC code will replace "A/T Initial start" if there had been an actual incident with the transmission after the power to the transmission control unit was interrupted.